

ROGOWSKI LEAK METER

MODEL RLM-1

INSTRUCTION MANUAL

Thank you very much for selecting our model RLM-1 Flexible Leakage Current Meter.

This model is complex instrument and employ a very reliable mechanical/electronic design.

Before you use your new instrument, read this instruction manual completely and familiarize yourself thoroughly with all functions and keep this instruction manual carefully to take out whenever you need.

MULTI MEASURING INSTRUMENTS CO.,LTD.
Akihabara Murai Bldg. 7F, 1-26 Kanda Sakuma-cho,
Chiyoda-ku, Tokyo, Japan, 101-0025
TEL : +81-3-3251-7013 FAX : +81-3-3253-4278
Home Page : <http://www.multimic.com/>
E-mail : multi@multimic.com

SAFETY SUMMARY

observe by all means

- To use this instrument safely, read this "SAFETY SUMMARY" carefully and apply the instrument correctly.
- The CAUTIONs and WARNINGs which appear on the following pages are stated to prevent the operator & other people from the dangers and their properties from the damages beforehand.

- △ WARNING : This symbol indicates the contents "Possibilities of the death or the serious wound can be supposed" caused from mis-operations.
- △ CAUTION : This symbol indicates the contents "Possibilities of the injury or only the material damage can be supposed" caused from mis-operations.

△ WARNING

POSSIBLE ELECTRICAL SHOCK

- This instrument is for the use of low voltage circuit.
- Do not make measurements of power lines carrying more than AC 600V.
Before use, check and confirm the voltage of circuit to be measured.
- Apply only the coated cables and do not clamp the bare cables.

POSSIBLE ELECTRICAL SHOCK OR ACCIDENT

- Do not handle the instrument in the rain, at humid place, with a drop of water and or with wet hands.
- Do not use the instrument if the flexible CT is damaged and if the battery cover is off, do not operate this instrument.
- Replace the batteries after took off CT, etc. from the circuit.

POSSIBLE INSTRUMENT DAMAGE

- Do not disassemble this instrument.
- Do not twist, bend and or pull the flexible CT unnecessarily. It may cause quality deterioration and or breakage.

1. GENERAL

This instrument is the world first Live Line Clamp Insulation Resistance Tester which can measure insulation resistances of motors, electric appliances and circuits by clamping CT to the live lines. Formerly, the insulation resistances of motors, etc. have been measured after disconnected the power lines but nowadays, the insulation measurements are getting more & more difficult, as there are so many places where we cannot cut down the electricity easily.

2. CAUTION BEFORE USE

After open the box, check the appearance of instrument and confirm whether standard accessories are contained. Once if you found an damage or shortage, contact the sales agent or directly to us.

3. SPECIFICATIONS

1) CURRENT DETECTION SENSOR (FLEXIBLE CT)

Model No.	: FZCT-220
Method	: Rogowski Split-core type
Inside Diameter	: Φ 210mm (total length 650mm)
Influence of Residual Current	: less than 0.5A (at the most sensitive place by AC50A)
Withstanding voltage	: AC2200V/1 minute
Length of Lead Wire	: Approx. 2m between CT and Display Unit

2) MEASURING PART

Measuring function	: AC Line current and Leakage Current
Measuring method	: Clamp CT
Measuring range	: AC 3000mA/30A/300A/3000A
Change of range	: 4 range manual by rotary switch
A/D conversion	: Dual integration mode
Sampling rate	: 2 times/sec.
Display	: LCD, 3200 count with annunciator
Data hold indication	: "DH" mark on LCD
Over range indication	: "OL" mark on LCD
Signal output for recorder	: DC 300mV to full scale of each range (output impedance : less than 10K Ω)
Auto power off	: Approx. 10 minutes after power on and can power on again by once setting range switch to off. In case of using recorder cable, this function is cancelled.


3) GENERAL SPECIFICATIONS

Circuit voltage	: less than AC 600V
Operating temperature	: 0~40°C, < 80%RH (without condensation)
Storage temperature	: -10~60°C, < 70%RH (without condensation)
Withstanding voltage	: AC 2000V/1 minute
Consumption current	: 7mA (approx. 200h for continuous use)
Power supply	: LM-3 × 6
Dimension/Weight	: Display part : 159(W) × 105(H) × 53(D)mm, approx. 350g w/o batteries
	CT part : inside diameter 210mm, approx. 250g
Accessories	: Soft Case, Test Lead, Batteries, Instruction Manual

4) ACCURACY (23°C±5°C, less than 85%RH, 50/60Hz)

Range	Resolution	Accuracy
3000mA	1mA	±3%rdg±10dgt
30A	0.01A	±2.5%rdg±5dgt
300A	0.1A	
3000A	1A	
Signal Output		±2% F.S.

4. NAME OF PART & EXPLANATION

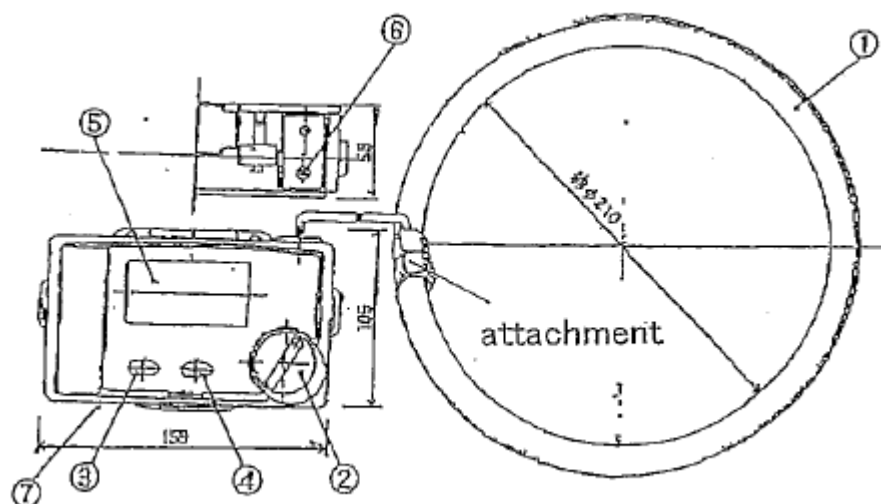


- ① Current Sensor : For current detection, flexible type
- ② Range Switch : Power on/off and range selection.
- ③ Filter Switch : By pressing this switch, "FL" mark on LCD and Filter function starts which will cut high frequency component. By pressing switch once again, this function will be released.
- ④ 「D-HOLD」 Switch: By pressing this switch, "DH" mark on LCD and the displayed value will be hold. By pressing switch once again, this function will be released.
- ⑤ LCD Display : Showing measured value, unit and battery condition.
- ⑥ 「REC」 Recorder Output : Connect with recorder for long period measurement.
Output is DC 300mV to the full scale of each range.
- ⑦ Battery cover (Back side) : By removing this cover, batteries can be replaced.

5. OPERATION

5-1) REPLACEMENT OF BATTERIES

- 1) Remove the screw fixing battery cover at the rear case by (–) driver or coin (turn to left) and open off battery cover.
- 2) Replace the batteries in the correct direction of (+)(–) polarity according to the indication graved in battery compartment.
- 3) In case of not using instrument for a long time, remove all the batteries to avoid exhaustion and leakage of batteries.

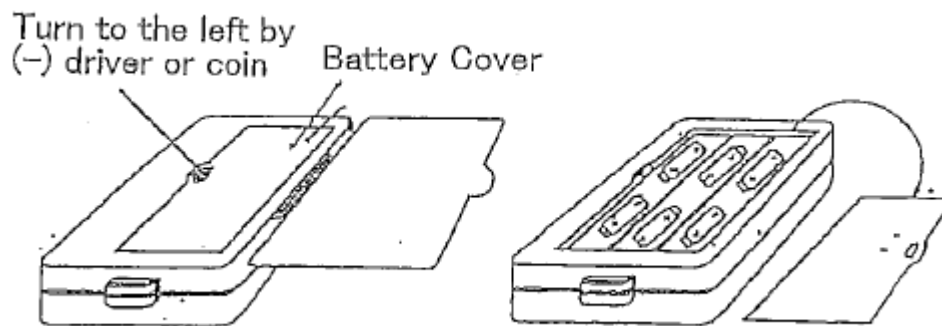

⚠ WARNING

- ① It may cause leakage of batteries and or defect of electric circuit, if the batteries are placed at wrong polarity position.
- ② Do not dissolve the batteries and or throw them into the fire.

⚠ WARNING

POSSIBLE ELECTRICAL SHOCK OR ACCIDENT

- Do not replace the batteries under the conditions of measuring current.
- Do not operate the instrument with battery cover off.

5-2) MEASUREMENT

To use the instrument safely, strictly observe WARNING and CAUTION stated on this manual.

⚠ WARNING

POSSIBLE ELECTRICAL SHOCK

- For the safety, use this instrument in the circuit less than AC 600V.
Before use, confirm circuit voltage to be measured.

POSSIBLE ELECTRICAL SHOCK OR ACCIDENT


- Do not handle the instrument in the rain, at humid place, with a drop of water and or with wet hands.
- Do not use this instrument if flexible CT and or case of display part are damaged.
- Do not operate this instrument if battery cover is off.

⚠ CAUTION

- At 3000mA range, the display hardly becomes “000” mA at “0” input but it is not wrong.
- It takes some while to get “0” display at the time of changing rotary switch from off to on but it is not wrong.

(1) MEASUREMENT OF LINE CURRENT

- ① Set the range switch from off to 3000A (Display will appear).
- ② Open the attachment part of flexible CT and clamp the conductor to be measured and close the attachment.
- ③ Select the appropriate range by range switch and read the displayed value. (In case of over range, "OL" mark will be displayed).

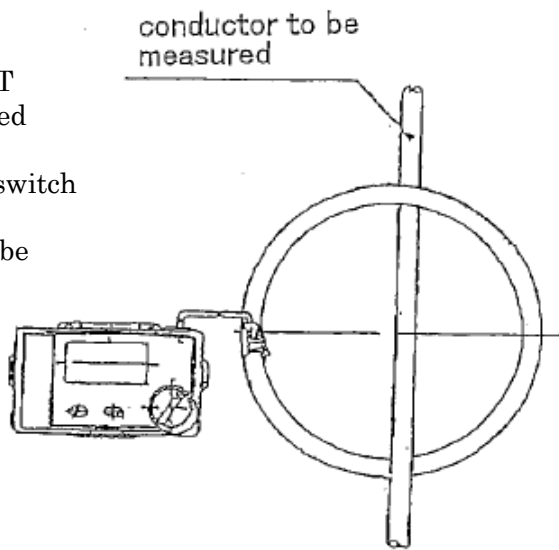

- ※ Use Data Hold function at the place where display can hardly read.
- ※ Use Filter function at the place where high frequency contains.

(2) MEASUREMENT OF LEAKAGE CURRENT

① Measurement of Grounding Line

The operation is same manner as for line current.


② Measurement, except for Grounding Line

Clamp flexible CT to the conductor, 2 wires in case of single phase and 3 wires or 4 wires in case of three phase en bloc.

TECHNICAL POINT FOR LEAKAGE CURRENT MEASUREMENT


Current detection sensor (Flexible CT) for this instruments is core-less coil type without magnetic material. Accordingly, it is more affected by the influences of outer magnetic field and residual current in comparison with ordinary ZCT but more accurate measurement can be made by the following method:

Set the CT as the right drawing and turn it round one time, watching the displayed value. The least value is most accurate leakage current of the circuit to be measured.

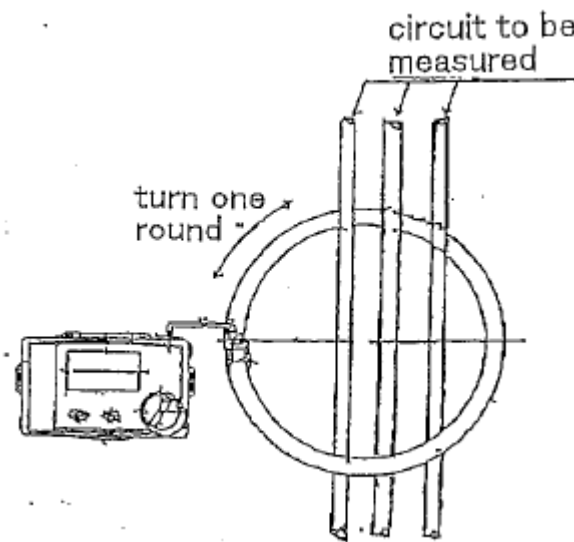

OPEN/CLOSE METHOD OF CURRENT DETECTION SENSOR (FZCT-220)


- To close flexible CT, put the joint part together and push insertion side into receptor position.
- To open flexible CT, firstly turn the joint part and put together arrow marks on the insertion and receptor side. Then, pull apart softly.

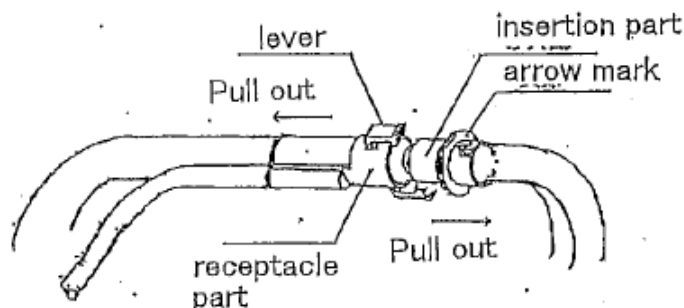

(3) OTHER MEASUREMENTS


① Measurement by using recorder output

To monitor current for a long period, use recorder output (REC).

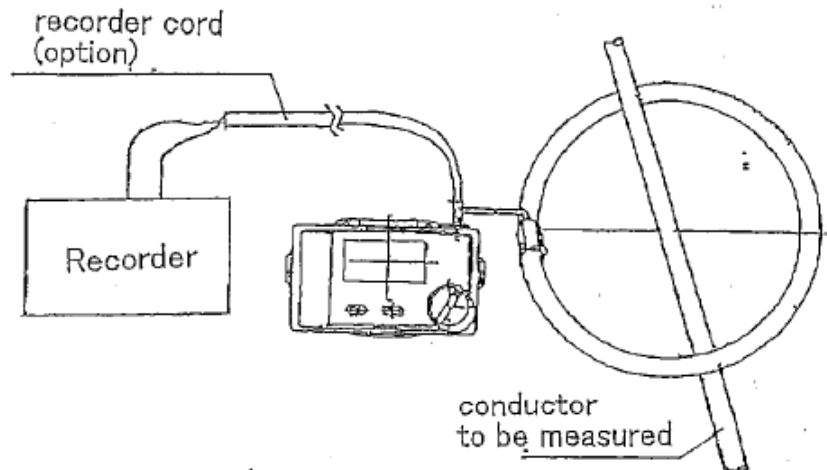

Insert the recorder cable ($\Phi 2.5\text{mm}$ plug) into "REC" terminal and connect with recorder. After insertion of cable, auto power off function is cancelled.

② Measurement for bigger diameter circuit by using 2 units

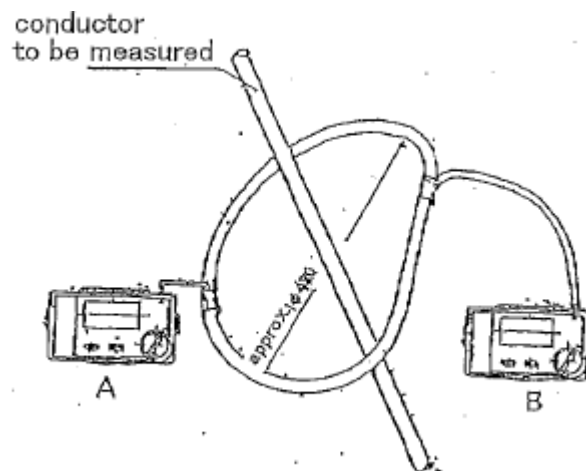

- Connect the receptor part of "A" with the insertion part of "B" and clamp CT to the conductor by using the insertion part of "A" and the receptor part of "B".
- Set the measuring range of "A" and "B" to the same.
- Read the displayed value of "A" & "B" and the total value ("A" + "B") is flowing current in the circuit to be measured.

REPAIR SERVICE

When requesting for repair service, please bring the instrument directly to the dealer where you bought.

When mailing the instrument, always pack it in its original or equivalent packing materials to avoid any damage during the transportation and also put together with documents showing your name, address, phone number and defect point.

WARRANTY

This instrument is sent out from our factory after the sufficient internal inspections but if you find any defect due to the fault in our workmanship or the original parts, Please contact the dealer where you bought the instrument.

The warranty period is 12 months from the date of purchase and the instrument shall be repaired at free of charge, provided that we judge the cause of defect is obviously resulted from our responsibility.

GURANTEE REGULATIONS

- 1.This instrument is warranted for the operation under normal use for 12 months from the date of purchase.
- 2.This warranty does not cover the following defects:
 - a. Defect caused from the improper use and operation.
 - b. Defect caused from the use, operation and storage beyond the original specifications, designs and conditions.
 - c. Defect caused from the renovations or repairs done by someone else than us or our representatives.
 - d. Defect not caused from our responsibilities.