High-precision process calibrator Model CED7000

WIKA data sheet CT 85.51

Applications

- Research and development laboratories
- Calibration service companies and service industry
- Industry (laboratory, workshop and production)
- Quality assurance

Special features

- Excellent accuracy of up to 0.0025 % of reading
- Measuring and simulation of thermocouples (13), resistance thermometers (9), resistance, voltage, current and pressure
- Entry of customer-specific resistance thermometer coefficients
- Beryllium-copper compounds reduce thermoelectric voltages
- Isolated mA/V measuring channel for complete transmitter calibration (measuring and simulation at the same time)



High-precision process calibrator, model CED7000

Description

General information

The model CED7000 process calibrator combines the capabilities of a signal, temperature and pressure calibrator in a single instrument. With the efficiency of a laboratory instrument, an additional isolated measuring channel and optional external pressure modules, the CED7000 is perfect for the widest range of calibration tasks.

Extensive application possibilities

The CED7000 has a wide range of application options. It can be used for calibration in industry (laboratory, production, workshops) and in laboratories and institutes.

Efficiency

The signal calibration capability of the CED7000 includes current, voltage and resistance. In the thermocouple and resistance thermometer mode, the unit offers a selection between 13 different thermocouples and 9 different resistance thermometers. For pressure measurement, an external pressure sensor is required. The best results are achieved by using the CPT6100 series. The accuracy and the resolution are dependent on the respective pressure sensor. The fully isolated measuring channel enables the calibration of transmitters. The CED7000 thus combines the two functions, measuring and simulation, in one instrument. The CED7000 is very easy to use. It supports direct entry using keyboard or cursor keys.

The CED7000 can be controlled via PC using RS-232, IEEE-488 or optionally a USB connection.

Certified accuracy

Every process calibrator model CED7000 is provided with a factory calibration certificate which certificates the accuracy of the instrument. On request, we can provide a DKD/DAkkS calibration certificate for this instrument.



Specifications Model CED7000

Base instrument	
Input and output	
Resistance thermometer (RTD)	Pt100 (385, 3926, 3916), Pt200, Pt500, Pt1000, Ni120, Cu10, YSI 400
Thermocouples	Types B, C, E, J, K, L, N, R, S, T, U, XK, BP
Voltage signal	DC 0 100 V
Current signal	DC 0 100 mA (output) DC 0 50 mA (input)
Resistance	04,000 Ω
Transmitter supply	
Voltage supply	DC 24 V ±10 V
Loop current	max. DC 24 mA
Resistance	HART [®] resistance: 250 Ω ±3 Ω (activatable)
Special features	
Settling time	less than 5 seconds
Warm-up time	30 minutes
Voltage supply	
Power supply	AC 100 240 V, 47 63 Hz
Power consumption	max. 15 VA
Permissible ambient conditions	
Operating temperature	0 50 °C
Storage temperature	-20 +70 °C
Calibration temperature (T_{cal})	18 28 °C
Temperature coefficient	10 % of the accuracy specification per $^\circ C$ outside the calibration temperature
Relative humidity	
Operation	< 80 % r. h. up to 30 °C < 70 % r. h. up to 40 °C < 40 % r. h. up to 50 °C
Storage	0 95 % r. h. (non-condensing)
Communication	
Interface	RS-232, IEEE-488 (GPIB)
Case	
Dimensions	48.3 x 17.7 x 27.9 cm (19.0 x 7.0 x 11.0 inch)
Weight	4 kg (8.82 lb)

CE conformity, certificates	
CE conformity	
EMC directive	2004/108/EC, EN 61326-1 emission (group 1, class B) and interference immunity (controlled electromagnetic environment) 2006/95/EC, EN 61010-1 and EN 61010-2-030 safety requirements for electrical equipment for measurement, control and laboratory use
Certificates	
Calibration	Standard: 3.1 calibration certificate per DIN EN 10204 Option: DKD/DAkkS calibration certificate
Recommended recalibration interval	1 year (dependent on conditions of use)

Approvals and certificates, see website

Voltage output 1)									
Range	Accuracy i	Accuracy in ± (% of reading +µV) Stability			Resolution	Maximum load			
	90 days		1 year		24 hours, ± (% of re	±1 °C ading +μV)			
0 100.000 mV	0.0025	3	0.003	3	0.0005	2	1 μV	10 mA	
0 1.00000 V	0.0025	10	0.003	10	0.0004	10	10 µV	10 mA	
0 10.0000 V	0.0025	100	0.003	100	0.0004	100	100 µV	10 mA	
0 100.000 V	0.0025	1 mV	0.003	1 mV	0.0005	1 mV	1 mV	1 mA	
TC output and input									
-10 +75.000 mV	0.0025	3 μV	0.003	3 μV	0.0005	2	1 μV	10 Ω	
Isolated voltage input							_		
Range	Accuracy i	n ± (% of rea	ading +mV)		Resolutio	n			
0 10.0000 V	0.005		0.2		100 μV	100 μV			
0 100.000 V	0.005		2.0		1 mV				
Current output ²⁾			-						
Range	Accuracy i	n ± (% of rea	ading +µA)		Resolutio	Resolution		Maximum inductive load	
	90 days		1 year						
0 100.000 mA	0.004	1	0.005	1	1 μA		12 V	100 mH	
Isolated current input ³)								
Range	Accuracy i	Accuracy in \pm (% of reading +µA)			Resolutio	n			
0 50.0000 mA	0.01	0.01 1		0.1 μA	0.1 μΑ				
Resistance output									
Range	Accuracy i	Accuracy in $\pm \Omega$		Resolutio	Resolution		rent		
	90 days		1 year	1 year					
5 400.000 Ω	0.012		0.015		0.001 Ω	0.001 Ω		1 3 mA	
5 4.00000 kΩ	0.25	0.3		0.01 Ω	0.01 Ω		100 μA 1 mA		
Resistance input									
Range	Accuracy i	n ± (% of rea	of reading + Ω)		Resolutio	n	Stimulus cu	rrent	
	90 days		1 year						
0 400.000 Ω	0.002 + 0.0	035	0.002 + 0.004		0.001 Ω	0.001 Ω		1 mA	
0 4.00000 kΩ	0.002 + 0.0	35	0.002 + 0.04		0.01 Ω	0.01 Ω 0.1 mA			
Measuring pressure									
Ranges	Dependent on pressure module								
Accuracy and resolution	Dependent on pressure module								
Units	and here ush		0.00.00	CO 05) and		00.00)	O (4 °C and 20	°C) kBa	

Output impedance: < 1 Ω; only positive output signal
 Only positive output signal
 Voltage supply DC 24 V ±10 V Loop current max. DC 24 mA Resistance HART[®] resistance: 250 Ω ±3 Ω (activatable)

Output and input	Measuring range	Accuracy in ± °C tcal ±5 °C	; 4) 5)
Thermocouples		90 days	1 year
Туре В	600 800 °C	0.42	0.46
	800 1,550 °C	0.39	0.39
	1,550 1,820 °C	0.44	0.45
Туре С	0 150 °C	0.25	0.30
	150 650 °C	0.21	0.26
	650 1,000 °C	0.23	0.31
	1,000 1,800 °C	0.38	0.50
	1,800 2,316 °C	0.63	0.84
Туре Е	-270100 °C	0.38	0.50
	-10025 °C	0.16	0.18
	-25 +650 °C	0.14	0.16
	650 1,000 °C	0.16	0.21
Туре Ј	-210100 °C	0.20	0.27
	-10030 °C	0.18	0.20
	-30 +760 °C	0.14	0.17
	760 1,200 °C	0.18	0.23
Туре К	-270100 °C	0.25	0.33
	-10025 °C	0.19	0.22
	-25 +120 °C	0.14	0.16
	120 1,000 °C	0.19	0.26
	1,000 1,372 °C	0.30	0.40
Туре L	-200100 °C	0.37	0.37
	-100 +800 °C	0.26	0.26
	800 900 °C	0.17	0.17
Туре N	-270100 °C	0.33	0.40
	-10025 °C	0.20	0.24
	-25 +410 °C	0.16	0.19
	410 1,300 °C	0.21	0.27
Type R	-50 +250 °C	0.58	0.58
	250 400 °C	0.34	0.35
	400 1,000 °C	0.31	0.33
	1,000 1,767 °C	0.30	0.40
Type S	-50 +250 °C	0.56	0.56
	250 1,000 °C	0.36	0.36
	1,000 1,400 °C	0.30	0.37
	1,400 1,767 °C	0.35	0.46
Туре Т	-270150 °C	0.51	0.63
	-150 0 °C	0.18	0.24
	0 400 °C	0.13	0.16
Туре U	-200 0 °C	0.56	0.56
	0 600 °C	0.27	0.27
Туре ХК	-200100 °C	0.22	0.22
	-100 +300 °C	0.12	0.13
	300 800 °C	0.19	0.20
Туре ВР	0 200 °C	0.42	0.42
	200 600 °C	0.32	0.32
	600 800 °C	0.39	0.40
	800 1,600 °C	0.45	0.46
	1,600 2,000 °C	0.57	0.58
	2,000 2,500 °C	0.67	0.80

4) The accuracy does not include the error of the thermocouple.
5) The accuracy includes the error of cold junction compensation. It is not specified separately.


Input	Measuring range	Accuracy in ± °C tcal ±5 °C	6) 7)
Resistance thermometer and thermistor		90 days	1 year
Ρt385, 100 Ω	-20080 °C	0.012	0.013
	-80 +100 °C	0.018	0.020
	100 300 °C	0.022	0.024
	300 400 °C	0.025	0.026
	400 630 °C	0.031	0.033
	630 800 °C	0.037	0.038
Pt3926, 100 Ω	-20080 °C	0.012	0.013
	-80 0 °C	0.014	0.015
	0 100 °C	0.016	0.017
	100 300 °C	0.026	0.022
	300 400 °C	0.021	0.026
	400 630 °C	0.024	0.032
Pt3916, 100 Ω	-200190 °C	0.009	0.010
	-19080 °C	0.012	0.013
	-80 0 °C	0.014	0.015
	0 100 °C	0.016	0.017
	100 300 °C	0.021	0.022
	300 400 °C	0.024	0.026
	400 600 °C	0.030	0.031
	600 630 °C	0.031	0.033
Ρt385, 200 Ω	-20080 °C	0.047	0.053
	-80 0 °C	0.050	0.056
	0 100 °C	0.053	0.060
	100 260 °C	0.054	0.060
	260 300 °C	0.062	0.069
	300 400 °C	0.064	0.071
	400 630 °C	0.079	0.088
Ρt385, 500 Ω	-200 0 °C	0.023	0.025
	0 100 °C	0.026	0.028
	100 300 °C	0.031	0.034
	300 400 °C	0.035	0.038
	400 630 °C	0.041	0.045
Ρt385, 1,000 Ω	-200 0 °C	0.014	0.015
	0 100 °C	0.017	0.018
	100 300 °C	0.022	0.024
	300 400 °C	0.024	0.026
	400 630 °C	0.031	0.033
Νi120, 120 Ω	-80 +260 °C	0.008	0.009
Cu427, 10 Ω	-100 +260 °C	0.097	0.110
YSI 400	15 50 °C	0.005	0.007
SPRT	-200 +660 °C	0.05	0.06

6) 4-wire input7) The accuracy does not include the error of the probe.

Output Resistance thermometer and thermistor	Measuring range	Accuracy in ± °C tcal ±5 °C 90 days	; 8) 1 year
Pt385, 100 Ω	-200 +800 °C	0.04	0.05
Pt3926, 100 Ω	-200 +630 °C	0.04	0.05
Pt3916, 100 Ω	-200 +630 °C	0.04	0.05
Ρt385, 200 Ω	-200 +400 °C 400 630 °C	0.35 0.42	0.40 0.50
Pt385, 500 Ω	-200 +630 °C	0.15	0.17
Pt385, 1,000 Ω	-200 +630 °C	0.07	0.09
Νi120, 120 Ω	-80 +260 °C	0.02	0.02
Cu427, 10 Ω	-100 +260 °C	0.30	0.38
YSI 400	15 50 °C	0.005	0.007

8) 2-wire output

Dimensions in mm

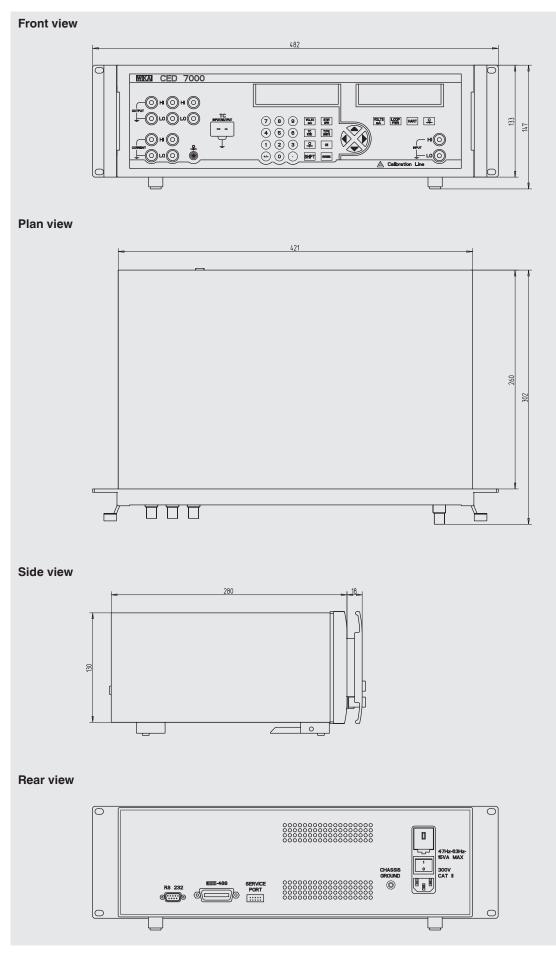

Handling

The CED7000 process calibrator is very simple and user-friendly in operation.

The values can be entered both directly and via the cursor keys. When entering the values directly, the actual value is entered using the numerical keys, the cursor keys are used to change individual digits.

In the voltage mode, the CED7000 automatically sets the appropriate range for the value entered in order to always achieve the highest accuracy.

Voltage mode

The process calibrator offers four precision voltage simulation ranges (100 mV, 1 V, 10 V, 100 V) with an accuracy of 0.003 % of reading (30 ppm). These ranges are ideal for the calibration of a wide range of different DC voltage instruments. All voltage simulations are set in less than 20 ms to their

full specification. It makes the CED7000 ideal for automatic calibration systems.

An automatic operate/standby function guarantees that a voltage of more than DC 30 V must be acknowledged by the operator before the voltage is made available at the terminals. This provides the optimal protection for the instruments to be calibrated against overvoltage.

Current mode

The CED7000 has a very precise current simulation range (100 mA) with an accuracy of 0.005 % of reading (50 ppm). This provides ideal conditions for the calibration of process instruments, particularly 4 ... 20 mA instruments. With a maximum output voltage of DC 12 V at 100 mA, a wide range of different DC current measuring instruments can be calibrated. As the voltage mode, this mode provides a fast reaction time and an operate/standby function.


Thermocouple mode

The CED7000 can display and simulate 13 different thermocouple types. Its thermocouple input and output are cold-junction compensated using an extremely stable Pt1000 sensor.

Resistance thermometer mode


Nine different resistance thermometer types as well as YSI 400 and resistances for non-standard curves can be read and simulated. The coefficients A, B, C and R0 can be entered directly. The instrument can save up to five customerspecific resistance thermometers. The performance of the CED7000 can be compared with other resistance measuring instruments, however, the display is always active with a resolution of 0.001.

Front view

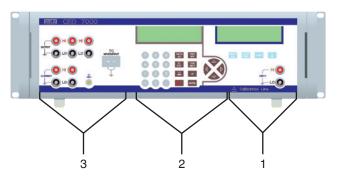

- (1) Isolated measuring channel
- (2) Primary input/output display and operating elements
- (3) Primary input/output connections

Primary input and output connections

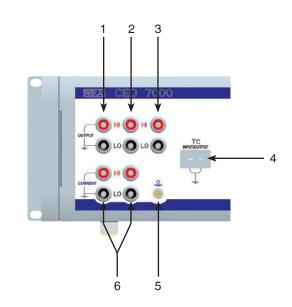

- (1) Voltage output
- (2) Current output
- (3) Resistance thermometer and resistance output
- (4) Thermocouple input/output
- (5) Connection for external pressure sensor
- (6) Resistance thermometer and resistance input

Pressure mode

With the CED7000, pressure can be displayed in many units with an accuracy of up to 0.01 % of span. The isolated measuring channel makes it possible to display pressure simultaneously in different units. All precision pressure sensors of the CPT6100 series can be connected.

Remote control

All operating functions can be activated and read via RS-232, IEEE-488 or USB interfaces. For this, Windows[®] HyperTerminal or a different ASCII code-based software can be used. The use of customer-specific programmes is also possible if they are written using programming software similar to C++.

Set-point control

Up to nine set points can be defined for each output mode. Set points can be very easily checked using three keys. Any number of specified set points can be automatically called up with complete control of the dwell time. This function allows fast performing and repetition of the tests.

Perfect accuracy/stability

The stability and accuracy of the CED7000 is fully traceable to DKD/DAkkS standards. The accuracy is specified for 90 days and for a year interval. Manual zero calibration can be carried out for the thermocouple input, resistance input and pressure function in order to avoid offsets.


Flexible output

Five-way screw and plug-in connections provide a wide range of connection options. A multi-LEMO connector is used for the connection of an external pressure sensor, a miniature connector input is provided for thermocouples.

Isolated measuring channel


The CED7000 features a completely isolated measuring channel which allows the user to calibrate transmitters. This channel has a DC 24 V voltage supply for supplying 2-wire transmitters and an activatable HART[®] resistor.

Interfaces on the rear side

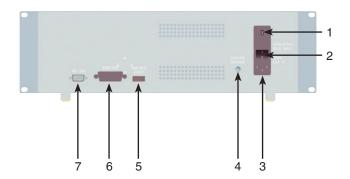

- (1) Fuse compartment
- (2) Power switch
- (3) AC connection per standard IEC
- (4) Grounding (case)
- (5) Service connection
- (6) IEEE-488
- (7) RS-232 (USB with adapter)

Isolated measuring channel

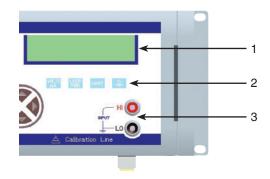

- (1) Display
- (2) Function keys
- (3) Input for current and voltage

Keyboard

Teyboard	OUTPUT	SHIFT 7	Switching between input and output	
Primary control keys	INPUT	SHIFT 8	mode	
OUTPUT INPUT ZERO	ZERO	SHIFT 9	Zeros the input for pressure, TCs and RTDs	
7 8 9 5 SETUP CJC °C/°F 5	SETUP	SHIFT 4	Settings	
	CJC	SHIFT 5	Selection of internal or external cold junction compensation	
SET RECALL AUTOSET	°C/°F	SHIFT 6	Selection of Celsius or Fahrenheit	
1 2 3 RNG LOCK LOCAL EXP	SET	SHIFT 1	Entering set points	
+/- 0 .	RECALL	SHIFT 2	Recalling set points	
	AUTOSET	SHIFT 3	Automatic stepping of selected set points	
	RNG LOCK	SHIFT	Selection of auto range or range lock	
	LOCAL	SHIFT 0	Finishing remote control	
	EXP	SHIFT	Selection of the exponent during the entry of customer-specific resistance thermometer coefficients	

VOLTS mA	Switching between voltage and current
TC RTD	Switching between TC and RTD
	Selection of the input mode for pressure
TYPE UNITS	Switching between individual TCs or RTDs
STBY OPR	Switching from standby to operating mode
ENTER	Enter key
CE	Clears the input in the display
SHIFT	Selection of secondary functions via the numeric keys



Control keys for the isolated measuring channel

	VOLTS mA LOOP PWR HART
VOLTS mA	Switching between voltage and current
LOOP PWR	Activation of the DC 24 V voltage supply
HART	Connection of a 250 Ω HART [®] resistor
- >	Selection of the input mode for pressure

Scope of delivery

- High-precision process calibrator model CED7000
- Operating instructions
- 3.1 calibration certificate per DIN EN 10204
- Power cord

Option

Certificates

DKD/DAkkS certified accuracy

Accessories

Test cables

- Thermocouple wire kit J, K, T, E with plugs
- Thermocouple wire kit R/S, N, B with plugs
- Beryllium copper cable with low thermoelectric voltage (red)
- Beryllium copper cable with low thermoelectric voltage (black)

Interface

- Null-modem cable
- USB serial adapter

Ordering information

Model / Mains voltage / Calibration / Additional order information

© 2008 WIKA Alexander Wiegand SE & Co. KG, all rights reserved. The specifications given in this document represent the state of engineering at the time of publishing. We reserve the right to make modifications to the specifications and materials.

WIKA data sheet CT 85.51 · 09/2014

Page 11 of 11



WIKA Alexander Wiegand SE & Co. KG Alexander-Wiegand-Straße 30 63911 Klingenberg/Germany Tel. +49 9372 132-0 Fax +49 9372 132-406 info@wika.de www.wika.de